




Screw-On Wire Connectors

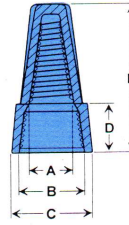

DIMENSIONS = INCHES

CAT. NO.	COLOR	WIRE COMBINATIONS	MAX VOLTS	A	B	C	D	E	BOX/BAG QTY	CASE QTY
HANGING BAG 25 PACK										
23271	GRAY	MAX: 3 #20 & 2 #22 MIN: 1 #20 & 1 #22	300V	.150	.264	.339	.228	.598	25	1,250
23272	BLUE	MAX: 3 #18 & 2 #20 MIN: 3 #22	300V	.161	.276	.386	.232	.693	25	1,250
23273	ORANGE	MAX: 4 #16 & 1 #20 MIN: 1 #18 & 1 #22	600V	.197	.390	.480	.307	.862	25	1,250
23274	YELLOW	MAX: 1 #18 & 4 #14 MIN: 1 #18 & 1 #14	600V	.236	.441	.551	.311	.937	25	1,250
23276	RED	MAX: 3 #14 & 4 #16 MIN: 1 #10 & 1 #20	600V 1000V FIXTURES & SIGNS	.276	.504	.630	.350	1.047	25	1,250
BOXED 100 PACK										
23071	GRAY	MAX: 1 #14 & 1 #20 MIN: 2 #22	300V	.150	.264	.339	.228	.598	100	15,000
23072	BLUE	MAX: 3 #16 MIN: 2 #22	300V	.161	.276	.386	.232	.693	100	15,000
23073	ORANGE	MAX: 4 #16 & 1 #20 MIN: 1 #18 & 1 #22	600V	.197	.390	.480	.307	.862	100	10,000
23074	YELLOW	MAX: 1 #18 & 4 #14 MIN: 1 #18 & 1 #14	600V	.236	.441	.551	.311	.937	100	6,000
23076	RED	MAX: 3 #14 & 4 #16 MIN: 1 #10 & 1 #20	600V 1000V FIXTURES & SIGNS	.276	.504	.630	.350	1.047	100	3600
BAGGED BULK PACK										
23171	GRAY	MAX: 1 #14 & 1 #20 MIN: 2 #22	300V	.150	.264	.339	.228	.598	1,000	20,000
23172	BLUE	MAX: 3 #16 MIN: 2 #22	300V	.161	.276	.386	.232	.693	1,000	10,000
23173	ORANGE	MAX: 4 #16 & 1 #20 MIN: 1 #18 & 1 #20	600V	.197	.390	.480	.307	.862	500	10,000
23174	YELLOW	MAX: 1 #10 & 2 #14 & 1 #16 MIN: 3 #20	600V	.236	.441	.551	.311	.937	500	5,000
23176	RED	MAX: 3 #10 MIN: 3 #18	600V 1000V FIXTURES & SIGNS	.276	.504	.630	.350	1.047	500	5,000
BULK PAIL										
23179	GRAY	MAX: 1 #14 & 1 #20 MIN: 2 #22	300V	.150	.264	.339	.228	.598	-	16,000
23180	BLUE	MAX: 3 #16 MIN: 2 #22	300V	.161	.276	.386	.232	.693	-	11,000
23181	ORANGE	MAX: 4 #16 & 1 #20 MIN: 1 #18 & 1 #20	600V	.197	.390	.480	.307	.862	-	6,500
23182	YELLOW	MAX: 1 #10 & 2 #14 & 1 #16 MIN: 3 #20	600V	.236	.441	.551	.311	.937	-	4,000
23183	RED	MAX: 3 #10 MIN: 3 #18	600V 1000V FIXTURES & SIGNS	.276	.504	.630	.350	1.047	-	3,000
SMALL JAR										
23373	ORANGE	MAX: 4 #16 & 1 #20 MIN: 1 #18 & 1 #22	600V	.197	.390	.480	.307	.862	350	11,200
23374	YELLOW	MAX: 1 #18 & 4 #14 MIN: 1 #18 & 1 #14	600V	.236	.441	.551	.311	.937	250	8,000
23376	RED	MAX: 3 #14 & 4 #16 MIN: 1 #10 & 1 #20	600V 1000V FIXTURES & SIGNS	.276	.504	.630	.350	1.047	150	4,800
LARGE JAR										
23473	ORANGE	MAX: 4 #16 & 1 #20 MIN: 1 #18 & 1 #22	600V	.197	.390	.480	.307	.862	900	10,800
23474	YELLOW	MAX: 1 #18 & 4 #14 MIN: 1 #18 & 1 #14	600V	.236	.441	.551	.311	.937	600	7,200
23476	RED	MAX: 3 #14 & 4 #16 MIN: 1 #10 & 1 #20	600V 1000V FIXTURES & SIGNS	.276	.504	.630	.350	1.047	400	4800



WIRE CONNECTORS Wire Connectors

D2